

Inspection Report

12.07.2009

Advantage Inspection Piedmont

9611 Brookdale Drive Suite 100 / 155 Charlotte NC 28215



prepared for

Fred Johnson Susan Johnson Charlotte, NC



8616 Rolling Mountain Road Charlotte NC 28228

YOUR home inspection report from Advantage Inspection Piedmont opens the door to a world of resource, education, and promotional incentives designed to help protect your largest asset . . . your home!

Thank you for your Trust in Advantage Inspection Piedmont!

Robert W. Wilson

Robert Wilson NC Lic. #291 SC Lic. #048

Realtor: NA NA

Advantage Inspection

Table of Contents

12.07.2009

Advantage Inspection Piedmont

9611 Brookdale Drive Suite 100 / 155 Charlotte NC 28215

| Cover | Page 1 |
|--------------------------|--------------|
| Table of Contents | Page 2 |
| Client Letter | Page 3 |
| Invoice | Page 4 |
| Conditions / Contract | Page 5 - 6 |
| Report Summary | Page 7 |
| Photographs | Page 8 - 11 |
| General Information | Page 12 |
| Structural | Page 13 |
| Exterior | Page 14 - 15 |
| Roof & Attic | Page 16 |
| Plumbing | Page 17 - 18 |
| Plumbing - Water Heater | Page 19 |
| Plumbing - Bathroom | Page 20 |
| Electrical | Page 21 |
| Heating | Page 22 - 23 |
| Heating - Fireplace | Page 24 |
| Cooling | Page 25 - 26 |
| HVAC Distribution | Page 27 |
| Interior | Page 28 |
| Insulation & Ventilation | Page 29 |
| Appliances | Page 30 |
| Safety Inspection | Page 31 |
| Supplemental Information | Page 32 - 33 |

Definition of Evaluation Headings

- S = Satisfactory Component is not necessarily perfect but is functional allowing for normal wear and tear.
- $R = Needs \ repair Component \ does \ not \ function \ properly \ or \ adversely \ affects \ the \ habitability \ of \ the \ dwelling.$
- I = Investigate Further Component warrants further investigation by a specialist or requires subsequent observation(s).
- NP = Not Present Component was not present in the structure
- NI = Not Inspected Component was not inspected or the inspection was limited for some reason.

Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified repair person versiptains to purchase or sale.



Client Letter

12.07.2009

Advantage Inspection Piedmont

9611 Brookdale Drive Suite 100 / 155 Charlotte NC 28215

Dear Fred Johnson Susan Johnson

I want to thank you for selecting Advantage to conduct the inspection of your new property purchase. I do my very best to provide a comprehensive inspection and report. If after careful review there are any questions that you would like to ask, please do not hesitate to call.

We are often asked to revisit the site and confirm repairs were completed. We are happy to do this for an additional fee (currently \$150.00), provided we are informed which of the deficiencies noted in the report were agreed upon to be repaired.

Since changes may occur over time, Advantage Inspection also offers an annual follow up inspection to determine if any adverse changes have occurred in the major systems of your property, ie., structural, foundation (including moisture levels), roof, HVAC, plumbing, and electrical. A written report is \$250.00. We invite you to schedule this inspection at any time following a year of occupancy.

If you are interested in a warranty "with no claims denied" within 30 days of report completion, you may obtain a home warranty on your new residence by making application by telephone, fax, or mail through Advantage Home Warranty or online at www.advantagehomewarranty.com, or you may call our office for more information. Advantage Inspection is an approved inspection company whose reports are used by Advantage Home Warranty as a basis for issuing home warranties.

I appreciate your business and wish you well in your new home!

Sincerely,

Robert Wilson Owner



Invoice

12.07.2009

Advantage Inspection Piedmont

9611 Brookdale Drive Suite 100 / 155 Charlotte NC 28215

| BILL TO: | |
|---------------------------------------------|--|
| Fred Johnson Susan Johnson | |
| Charlotte, NC Day Phone: Other Phone: | |

INSPECTION ADDRESS

8616 Rolling Mountain Road Charlotte, NC 28228

INSPECTION NUMBER

T47U24R6706

REALTOR

NA NA

| DESCRIPTION O | F SERVICES | AMOUNT |
|----------------------------------------------------------------------|---------------|-----------------|
| Home Inspection | | \$550.00 |
| Radon Test | | |
| Mechanical or Structural only | | |
| Water Test | | |
| Termite Letter | | |
| Investor Report | | |
| | | |
| INVOICE PAYMENT DESCRIPTION | TOTAL BILLING | \$550.00 |
| Paid at the time of the inspection. Thank you for you prompt payment | | \$330.00 |
| | AMOUNT PAID | \$550.00 |
| Thank-you for using Advantage Inspection Piedmont. | AMOUNT DUE | \$0.00 |

COMMENTS ON THE INSPECTION OR SERVICE

PLEASE ENCLOSE A COPY OF THIS BILL OR WRITE THE INSPECTION NUMBER ON YOUR CHECK AND REMIT IMMEDIATELY TO:

Advantage Inspection Piedmont 9611 Brookdale Drive Suite 100 / 155 / Charlotte, NC 28215 (704)684-0351 / Fax (704)625-3607



Service Contract

12.07.2009

Advantage Inspection Piedmont

9611 Brookdale Drive Suite 100 / 155 Charlotte NC 28215

Client(s): Fred Johnson Inspection Address: 8616 Rolling Mountain Road Inspector: Robert Wilson NC Lic.
Susan Johnson Charlotte, NC 28228 #291 SC Lic. #048

Inspection Date: 12/07/2009 Inspection Costs: \$550.00

I understand and accept that the Inspection Report will be sent to me and/or my authorized representative (person ordering inspection) only: (please initial)

This is our report of a visual inspection of the readily accessible areas of this building, in accordance with the terms and conditions in the PRE-INSPECTION AGREEMENT, which is a part of this Report and incorporated herein. Please read the remarks printed on each page and call us for any explanation of any part of this Report, written or printed, which you do not fully understand. Advantage Inspection Piedmont, LLC. hereafter to be called COMPANY. Customer hereafter called CLIENT.

PRE-INSPECTION AGREEMENT

COMPANY agrees to conduct an inspection for the purpose of alerting the CLIENT to major deficiencies in the condition of the property. The inspection and report are performed and prepared for the sole, confidential and exclusive use and possession of the CLIENT. The written report will include the following only.

ROOF ATTIC KITCHEN CABINETS PLUMBING FOUNDATION EXTERIOR FIREPLACE STRUCTURAL ELECTRICAL CRAWL SPACE INTERIOR BASEMENT HEATING AIR CONDITIONING MATERIALS USED APPLIANCES INSULATION ITEMS AND SYSTEMS NOT INCLUDED IN THE INSPECTION REPORT ARE AS FOLLOWS:

SWIMMING POOLS WATER QUALITY SEPTIC SYSTEMS RECREATIONAL EQUIPMENT CENTRAL VACUUM WATER FILTERS SPRINKLER SYSTEMS PORTABLE APPLIANCES WINDOW AC SOLAR SYSTEMS UNDERGROUND UTILITIES PERSONAL PROPERTY COSMETIC ITEMS DRAIN FIELDS SECURITY SYSTEMS DETACHED BUILDINGS ASBESTOS RADON INTERCOMS ENVIRONMENTAI ISSUES CEILING FANS ALUMINUM WIRING CONNECTIONS LOW VOLTAGE WIRING SYSTEMS SELF CLEANING OVEN FUNCTIONS SAFETY GLAZING IN ANY DOOR OR WINDOW EVALUATE THE UNIFORMITY OR ADEQUACY OF THE HVAC SYSTEM TO THE VARIOUS ROOMS CONCEALED INSULATION BLINDS OR WINDOW TREATMENTS PRESENCE OR CONDITION OF BURIED FUEL TANKS FENCES DETACHED BUILDINGS PROPERTY VALUES OR SUITABILITY OF THE PROPERTY FOR ANY SPECIALIZED USE THE METHODS, MATERIALS, AND COSTS OF CORRECTIONS. THERMOSTATIC CONTROLS, TIMERS OR INDICATOR LIGHTS ARE NOT CHECKED FOR ACCURACY OR CALIBRATION. LIFE EXPECTANCY OF ANY ITEM OR SYSTEM WILL NOT BE DETERMINED.

- 1. It is understood and agreed that this inspection will be of readily accessible areas of the building and is limited to visual observations of apparent conditions existing at the time of the inspection only. Latent and concealed defects and deficiencies are excluded from the inspection, items and systems will not be dismantled. The inspector is not required to move personal property, debris, furniture, equipment, carpeting or like materials which may impeded access or limit visibility. Crawl spaces will not be entered if there is less than two feet of clearance or inspector feels endangered. The inspection is not intended to be technically exhaustive. The cost estimates quoted in the report are estimates based upon the inspector's judgment or a range of prices available in the area. Individual bids from contractors can vary substantially from these ranges depending on the quality of the work, the circumstances, and the contractors submitting bids. The CLIENT is urged to solicit bids from State Licensed contractors for repairs before closing.
- 2. Maintenance and other items may be discussed, but they are not a part of this inspection. The report is not a compliance inspection or certification for past or present governmental codes or regulation of any kind.
- 3. Some items are checked by a sample as expressly and specifically identified in the inspection report. Pressure gauges are not used to test air conditioners. Garbage disposers are checked for on and off operation only. Only the dishwasherâ¢^{TMs} ability to fill and drain properly is checked. Dishwashers, ranges, ovens, microwaves and like appliances, and their timers, controls or elements are not checked. Self cleaning ovens are not operated or inspected. Remote controls for garage doors or any other appliances or systems are not checked. Electrical outlets are randomly checked. A sampling of windows and doors will be operated.
- 4. This inspection and report does not address and is not intended to address the possible presence of or danger from any potentially harmful substances and environmental hazards including but not limited to mold, mildew, microbial organism, radon gas, lead paint, asbestos, urea formaldehyde, carbon monoxide, carbon dioxide, toxic or flammable chemical, water or airborne related illness or disease, and all other similar or potentially harmful substances. The CLIENT is urged to contact a reputable specialist if information, identification or testing for the above is desired. In addition, the presence or absence of rodents, termites, or other insects / vermin is not covered by this inspection.
- 5. Because of the proprietary nature of burglar alarms, we do not inquire into their operation nor do we attempt to check them. Immediately prior to settlement, we suggest that the CLIENT about their operation and service procedures to determine whether they are owned or leased from a servicing company.
- 6. It is the responsibility of the CLIENT to furnish the inspector with a list of any defects that are known at the time of the inspection. All disclosure statements must be given to the inspector immediately. The CLIENT is encouraged to attend the inspection. This inspection is to be considered a point in time inspection.
- 7. We advise our CLIENTS that are purchasing homes with community or private wells or any house that may have lead in the water supply system to have the water tested for heavy metals, lead, coliform bacteria, nitrates, high sodium content, toxic or nuisance substances, etc.
- 8. The CLIENT should immediately put in writing to the COMPANY problems or disputes with the service being provided. Communications must be consistent in that the party originally accompanying the inspector will be the party resolving the problem.
- 9. Any recommendations made concerning repairs or additional inspections should be made by a licensed contractor or engineer.
- 10. The COMPANY will make every effort to uncover all items needing repairs, however it is understood that there may be items not found. This report covers only major repairs that are needed. Major repairs are considered repairs that cost over \$2,500.00.

- 11. The COMPANY assumes no liability and shall not be liable for any mistakes, omissions, or errors in judgment of its employees, or sub contractors, beyond the cost of the report. This limitation of liability shall include and apply to all consequential damages, bodily injury and property damage of any nature. This report is prepared exclusively for the CLIENT named above and is not intended for third party dissemination. This report shall not be forwarded to any other potential purchaser of the property if the CLIENT decides against the purchase of this property. The COMPANY accepts no responsibility for misinterpretation of this report.
- 12. This report follows the PROFESSIONAL CODE OF ETHICS AND UNIFORM STANDARDS OF PRACTICE of the State of North Carolina Home Inspectors Licensure Board. Any disputes or questions in the report should be directed to this publication for clarification. A copy of this booklet is in the office and may be obtained by calling the office. Copies are available for \$10.00 each.
- 13. Payment is expected and due upon completion of the inspection. There will be a billing charge for inspections not paid on completion, and an additional service charge of 1 ½% per month (18% per annum) for accounts not paid within 30 days. There will be a \$25.00 returned check charge. Any and all legal fees incurred by the COMPANY, will be charged to the CLIENT. Both parties agree that the COMPANY, and its employees and agents, assume non liability or responsibility for the cost of repairing or replacing any unreported defects or deficiencies, either current or arising in the future, or for any property damage, consequential damage or bodily injury of any nature.
- 14. THE INSPECTION AND REPORT ARE NOT INTENDED OR TO BE USED AS A GUARANTEE OR WARRANTY, EXPRESSED OR IMPLIED, REGARDING THE ADEQUACY, PERFORMANCE, LIFE EXPECTANCY OR CONDITION OF ANY INSPECTED STRUCTURE, ITEM OR SYSTEM. THIS REPORT IS TO BE CONSIDERED A POINT IN TIME INSPECTION, MEANING THE SYSTEMS AND ITEMS REPORTED ON ARE WORKING AS REPORTED AT THE TIME OF THE INSPECTION.
- 15. ANY DISPUTE, CONTROVERSY OR CLAIM ARISING OUT OF, OR RELATING TO, THIS AGREEMENT OR THE BREACH THEREOF SHALL BE SUBMITTED TO FINAL AND BINDING ARBITRATION UNDER THE EXPEDITED ARBITRATION RULES OF THE NATIONAL ACADEMY OI CONCILIATORS. THE DECISION OF THE ARBITRATOR APPOINTED THERE UNDER SHALL BE FINAL AND BINDING AND JUDGMENT ON THE AWARD MAY BE ENTERED IN ANY COURT OF COMPETENT JURISDICTION.

I HAVE READ OVER THIS PRE INSPECTION AGREEMENT AND FULLY UNDERSTAND AND ACCEPT ALL OF THE CONDITIONS OUTLINED THROUGHOUT THIS REPORT AND HEREBY ACKNOWLEDGED THIS BY MY ACCEPTANCE OR BY MY PAYMENT OF THIS REPORT.

| CLIENT | | DATE |
|----------------------------------------------------------|------|------|
| | | |
| CLIENT | DATE | |
| Robert Wilson License Number NC 291 License Number SC 48 | DATE | |



Report Summary

12 07 2000

Advantage Inspection Piedmont

9611 Brookdale Drive Suite 100 / 155 Charlotte NC 28215

Prepared Fred Johnson For: Susan Johnson

Report #: T47U24R6706

Inspection 8616 Rolling Mountain Road Address: Charlotte, NC 28228

Real Estate NA NA

Agent:

This summary is not the entire report. The full report may include additional information of interest or concern to the client. It is strongly recommended that the client promptly read the complete report. For information regarding the negotiability of any item in this report under a real estate purchase contract, contact your North Carolina real estate agent or an attorney.

THE FOLLOWING ITEMS SHOULD BE CHECKED FOR EXTENT OF DAMAGE AND/OR REPAIRED BY QUALIFIED REPAIR PERSON

Needs Repair

Exterior

- 1. Small gap noted at the bottom center of the front double doors and will allow air infiltration. Repair as needed.
- 2. The dead bolt lock at the rear door will not smoothly close and lock. The bottom door knob is very hard to operate. Repair or adjust as needed.
- 3. The dead bolt lock at the side garage door will not smoothly close and lock. The bottom door knob is very hard to operate. Repair or adjust as needed.

Roof & Attic

4. Some of the splash blocks are missing at the downspouts. Install as needed.

Plumbing - Water Heater

5. There is a small gap around the flue pipe in the attic at the water heater. The hole should be filled or repaired to keep water from entering. The water heater was off upon arrival for inspection. It was turned on and heated normally during the time of inspection. At the end of the inspection the water heater was turned off.

Plumbing - Bathroom

- 6. The flush valve at all of the bathrooms are either broken. leaking or continue to run. All of these should be replaced by a qualified professional.
- 7. The master bath jet tub would turn on and off repeatedly. I tried to cut the unit off but it would come back on later. I turn the breaker off so the unit would not come back on. Repair is needed by a qualified repair professional.

Heating

- 8. The gas valve was found to be taped up and the smell of gas was noted in the crawl space at the HVAC unit. The furnace also would continue to start and stop in a very short period of time. When running the furnace had a rumbling noise. I turned the unit off at the crawl space switch because I felt it was not safe. The unit should be serviced and any needed repairs by a qualified professional before moving into.
- 9. The furnace in the crawl space should have a screen placed over the opening of the flue pipe to prevent pest from entering. A repair professional should make any needed repairs.

Appliances

10. The pop up range hood did not respond when tested. Repair is needed by a qualified repair professional.

Needs Further Investigation

Heating - Fireplace

11. The gas logs did not have the pilot light on during the inspection. Home inspectors can not light the pilot light. A gas professional should be called to light and re inspect these logs before use or closing.

Cooling

- 12. The air conditioner serving the main level was not tested due manufacturer's recommendations not to operate when the outdoor temperature is less than 65 degrees. Unit should be serviced by a HVAC professional.
- 13. Cooling function of heat pump at the second floor was not tested due manufacturers recommendations not to operate when the outdoor temp. is less than 65 degrees. Unit should be serviced by a qualified HVAC professional before closing.



Front view of subject property



Front view of subject property



Rear view of subject property



Rear view of subject property



View of flue pipe missing the entrance screen



View of AC units

INSPECTION PICTURE ADDENDUM



View of gas regulator at the crawl space furnace.

***** GENERAL COMMENTS ON THE INSPECTION *****

Please review the entire report carefully. For quick reference of defective items and inspector notes, refer to the summary page near the beginning of this report.

INSPECTION TIME

10:00AM

PEOPLE PRESENT AT THE INSPECTION

Inspector Only

APPROXIMATE AGE

2

HOME STYLE

Traditional

CONSTRUCTION TYPE

Wood Frame

WEATHER AND SOIL CONDITIONS

Clear at the time of inspection with recent heavy rain

TEMPERATURE

38 Degrees Fahrenheit

STRUCTURE OCCUPIED

No

RESIDENCE TYPE

Single family detached

NUMBER OF STORIES

Two

APPROXIMATE HOUSE ORIENTATION

East

LOT DESCRIPTION

Typical residential lot.

| S = Item is satisfactory | R = Item needs repair | I = Item needs investigated | \mathbf{NP} = Item not present | NI = Item not inspected |
|------------------------------------------------------|------------------------------------------------------------------------------------------------------------------|----------------------------------------|----------------------------------|--------------------------------|
| STRUCTURAL | Report Number T47U24R6706 | | III = Tips, Tools, and | Savings S R I NP NI |
| | | FOUNDATION DETAILS | | |
| The crawl space was ente | Ispace DD & ACCESSIBLE AREAS ered at the crawl space door. Using a tion, duct work or low inaccessible and | | eas were inspected except those | e that were |
| FLOOR/SLAB- Dirt | | | | |
| SUBFLOOR- OSB | | | | |
| PIER/COLUMNS/FOU | ND. WALL- Piers & wall are CMU | J blocks & brick | | |
| FLOOR JOIST & SILL | .s. Conventional wood truss system | n | | |
| GIRDER- Triple, woo | d | | | |
| MOISTURE Woo | d Moisture content 15-17 % | Acceptable levels are below 19% | | |
| SUMP PUMP | | | | |
| CRAWL SPACE VAPO | DR BARRIER- Plastic | | | |
| | | ROOF DETAILS | | |
| | onventional wood rafters & bracing linspected using a flash light. However | ver parts of the attic were not inspec | ted due to limited access. | |
| Accessible areas in the at | Conventional wood joist & bearing tic were inspected from the floored as bists could not be inspected closely du | | le where visible. | |
| ROOF DECKING- OS | SB | | | |
| | | WALL DETAILS | | |
| Framing of exterior & int sheetrock and/or other was | terior walls appears to be 2 x 4 studs. | Unable to inspect wall framing for | condition and spacing of studs | due to |
| | ADDITIO | NAL STRUCTURAL ITEM (IF N | NEEDED) | |
| | | | | |

| S = Item is satisf | factory R = Item needs repair Report Number | I = Item needs investigated | \mathbf{NP} = Item not present | NI= Item not inspected |
|----------------------|----------------------------------------------------|-------------------------------------------|----------------------------------|------------------------|
| EXTERIO | T47U24R6706 | | = Tips, Tools, and | Savings S R I NP NI |
| WALL CLADD | ING- Brick | | | |
| | | | | |
| FLASHING | | | | |
| | | | | |
| TRIM | | | | |
| | | | | |
| FRONT DOOR- | 2 | | Wood | |
| Small gap noted | at the bottom center of the front double doo | ers and will allow air infiltration. Repa | ir as needed. | |
| REAR DOORS- | Double ☐ Fiberglass ☑ Glass | ✓ Metal ✓ Single ✓ | Wood | |
| The dead bolt loc | k at the rear door will not smoothly close a | nd lock. The bottom door knob is ver | y hard to operate. Repair or ad | just as needed. |
| SIDE DOORS- | ☐ Double ☐ Fiberglass ☑ Glass | ✓ Metal ✓ Single □ | Wood | |
| The dead bolt loc | k at the side garage door will not smoothly | | | ir or adjust as |
| needed. SLIDING GLAS | SS DOOR- | ed | | |
| | insulated Selective | ed - Tempered | | |
| WINDOWS- | | | E. v. | |
| (exterior side) | ☐ Awning ☐ Double Hung ☐ In ☐ Casement ☐ Fixed ☐ M | | • | |
| | Casement Fixed W | letai Single Hung Stori | ii i wood | |
| | | | | |
| GARAGE- Th | ree car attached DOOR | OPENER- Liftmaster (auto reverse | e), Liftmaster (auto reverse) | |
| | | | | |
| DECK- | | | | |
| | | | | |
| DECK RAILS- | | | | |
| | | | | |
| EXTERIOR BA | LCONY- | | | |
| | | | | |
| EXTERIOR BA | LCONY RAILS- | | | |
| | | | | |
| STOOP- Mas | sonry | | | |
| | · | | | |
| STOOP RAILS- | | | | |
| | | | | |
| PORCH- Ma | sonry and Concrete | | | |
| TORCH- IVIA | som, and concrete | | | |
| PORCH RAILS | | | | |
| I OKCII KAILS | - | | | |
| COEFIT/E A VEC | S Wood | | | |
| SOFFIT/EAVES | S- Wood | | | |

| S = Item is satisfactory R = Item needs repa | I = Item needs investigated | \mathbf{NP} = Item not present | NI= Item not inspected |
|-----------------------------------------------|------------------------------------|----------------------------------|------------------------|
| EXTERIOR T47U24R6706 | | = Tips, Tools, an | d Savings S R I NP NI |
| FASCIA- Wood | | | |
| | | | |
| DRIVEWAY- Concrete | | | |
| | | | |
| PATIOS/SLABS- Concrete | | | |
| | | | |
| WALKS- Concrete | | | |
| | | | |
| RETAINING WALLS- | | | |
| | | | |
| VEGETATION- Grass | | | |
| TREES/LIMBS | | | |
| TREES/ELWES | | | |
| GRADE/DRAINAGE | | | |
| | | | |
| | ADDITIONAL EXTERIOR ITEMS (IF | NEEDED) | |
| | | | |
| | | | |
| _ | | | |
| | | | |

| S = Item is satisfactory $R = Item needs repair$ $I = Item needs investigated$ | \mathbf{NP} = Item not present | NI = Item not inspected |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------|--------------------------------|
| ROOF Report Number T47U24R6706 | Tips, Tools, and | Savings S R I NP NI |
| ROOF COVERINGS- Fiberglass / Asphalt Composition ROOF STYLE- Gable & Hip | | |
| GUTTERS- Aluminum | | |
| DOWNSPOUTS- Aluminum | | |
| SPLASH BLOCKS DISCHARGE- Plastic pipe Drain pipes are underground and their condition or draining ability could not be evaluated. Some of downspouts. Install as needed. | of the splash blocks are missing | at the |
| FLASHING & ROOF PENETRATIONS | | |
| SKYLIGHTS | | |
| WATER PENETRATION | | |
| ADDITIONAL ROOF ITEMS (IF NEED | DED) | |
| ADDITIONAL ROOF HEMS (IF NEED | DED) | |
| | | |
| ROOF INSPECTED FROM: The roof was inspected from attic & from ground with binoculars. | | 1 |
| ROOF AREAS NOT INSPECTED | | 1 |
| Note: Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired purchase or sale. Apparent serviceability of roofing system is reported but is not a warranty or | | |

home inspector is NOT required to walk on the roofing or inspect attached accessories including solar systems, antennae and lightning arrestors.

| S = Item is satisfactory | 1 | I = Item needs investigated | \mathbf{NP} = Item not present | NI = Item not inspected |
|--------------------------|---------------------------------------------------------------------|---------------------------------------------|----------------------------------|-------------------------|
| PLUMBING | Report Number T47U24R6706 | | III = Tips, Tools, and Sav | ings S R I NP NI |
| | | WATER SUPPLY DETAILS | | |
| WATER SUPPLY TY | PE - ☐ Common ☐ P | Public Sewer Public Water V Septic | □ Well | |
| WATER SUPPLY- | Copper ✓ Not visable ✓ Galvanized ☐ Plastic | Polybutylene | | |
| The water meter is locat | ed in the front yard. Water supply | piping is buried and could not be inspected | 1. | |
| WELL PUMP- Manufa | acturer | Est. Age. | | |
| | | | | |
| WATER SHUT OFF I | OCATION- Foundation | ▼ Meter | | |
| The main water cut off i | s located in a interior closet. | | | |
| WATER PRESSURE | Approximate P.S.I.C | G. 60 | | |
| | | WATER DISTRIBUTION DETAILS | | |
| WATER PIPES- | Copper Plastic | | | |
| | Galvanized Polybutylene | | | |
| | nes are plastic "pex" tubing. nes are concealed in floors and wa | lls and could not be observed. | | |
| FUNCTIONAL FLOW | | | | |
| Functional water flow w | as observed at all fixtures where to | esting was possible and practical. Washing | machine water flow was not tes | ted. |
| WATER PIPE SUPPO | RT | | | |
| | | | | |
| WATER PIPE INSUL | ATION | | | |
| | | | | |
| | | WASTE & VENT PIPE DETAILS | | |
| WASTE & VENT PIP | | zed | | |
| Majority of pines conce | ☐ Copper | at he observed | | |
| Majority of pipes concea | area in wans & noors and could no | ot be observed. | | |
| FUNCTIONAL DRAIN | | | | |
| Functional drainage was | s observed at all fixtures where test | ting was possible and practical. The washin | g machine drain was not tested. | |
| WASTE & VENT PIP | E SUPPORT | | | |
| | | | | |
| | | EQUIPMENT & FUEL STORAGE | | ~ [- - - - |
| WASTE PUMP (SOM | ETIMES CALLED A LIFT STA | ATION) | | |
| INTEDIOD EHEL STO | ORAGE / FUEL SUPPLY & VE | NT DIDING | | |
| INTERIOR FUEL ST | JAAGE/FUEL SUFFLI & VE | 111 II | | (·· |
| | | PLUMBING FIXTURES | | |
| OUTSIDE FAUCETS | | | | |
| | | | | |
| KITCHEN SINK | | | | |
| | | | | |

| S = Item is satisfactory PLUMBING | Report 1 | | I = Item needs investigat | red NP | = Item not present | NI = Item not inspected |
|------------------------------------|----------|---------------------|----------------------------------|--------------|------------------------|-------------------------|
| TECHIDING | T47U24 | łR6706 | | | = Tips, Tools, and Sav | vings S R I NP NI |
| LAUNDRY CONNECT | ΓΙΟΝS- | Elect. Dryer Outlet | ☐ Gas Dryer Connections | ☐ Mop Sink | ☐ Washer | |
| | | | | | | |
| | | | | | | |
| | | ADDI | FIONAL PLUMBING ITEMS | S (IF NEEDEL |)) | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |

| S = Item is satisfactory | \mathbf{R} = Item needs re | epair | $\mathbf{I} = \text{Item nee}$ | ds investigated | NP = Item not present | NI = | Iten | n no | t ins | pecte | ed |
|--------------------------|------------------------------|------------------|--------------------------------|-----------------------|--------------------------------------|----------|-------|------|-------|-------|----|
| PLUMBING | Report Number T47U24R6706 | V | WATER HEA | ATER | = Tips, Tools, and S | avings | S | R | . I | NP | NI |
| WATER HEATER | Water Heater Location | Attic | | 50 | Gallon | Bill | | | | | |
| # 1 | Manufacturer American | 1 | | Serial Number | 0816T409888 | | _ | | | | l |
| | Estimated Age 2 | | | Model Number Water | 0732045 | | | ⊽ | | | |
| | ☐ Electric ☑ Gas | ☐ Other | ☐ Propane | Temperature | | | | | | | |
| There is a small gap aro | und the flue pipe in the att | tic at the water | er heater. The h | ole should be fille | ed or repaired to keep water from er | itering. | The | wat | er | | |
| heater was off upon arri | val for inspection. It was | turned on and | d heated normal | ly during the time | of inspection. At the end of the in | spection | ı the | wat | er | | |
| heater was turned off. | | | | | | | | | | | |

Note: Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified repair person prior to purchase or sale. If well water is used for drinking purposes, we recommend it be tested by a lab or the health dept. Underground septic systems, sewer lines, and water treatment equipment are not inspected. If present, we recommend a septic system inspection and/or contractor evaluation before closing. The home inspector is not required to: state the effectiveness of anti-siphon devices; determine whether water supply and waste disposal systems are public or private; operate automatic safety controls; operate any valve except water closet flush valves, fixture faucets, and hose faucets. The home inspector is not required to inspect: water conditioning systems; fire and lawn sprinkler systems; on-site water supply quantity and quality; on-site waste disposal systems; foundation irrigation systems; bathroom spas, except as to functional flow and functional drainage; swimming pools; solar water heating equipment; or inspect the system for proper sizing, design, or use of proper materials.

| S = Item is satisfactory | R = Item needs repair | I = Item needs investigated | \mathbf{NP} = Item not present | NI = Item not inspected |
|---------------------------------|----------------------------------------------------------------------|--------------------------------------------|-------------------------------------|-------------------------|
| PLUMBING | Report Number T47U24R6706 | BATHROOM | = Tips, Tools, and S | Savings S R I NP NI |
| BATH FIXTURES #1- | Second Floor Hall | | | |
| The flush valve at all of the | ne bathrooms are either broken. le | aking or continue to run. All of these | should be replaced by a qualified | professional. |
| DATH FIVELINES #2 | C IEI M · D · | | | |
| BATH FIXTURES # 2 - | | third to get the surit off but it would be | una haali an latan. I tuum tha huaa | lan off so the |
| | ould turn on and off repeatedly. It on. Repair is needed by a qualif | tried to cut the unit off but it would co | ome back on later. I turn the brea | ker off so the |
| | | | | |
| | | | | |
| BATH FIXTURES #3- | Second Floor Front bedroom | | | |
| | | | | |
| | | | | |
| | | | | |
| BATH FIXTURES #4- | First Floor Half Bath | | | |
| | | | | |
| | | | | |
| | | | | |
| BATH FIXTURES #5- | First Floor Bedroom | | | |
| | | | | |

Note: Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified repair person prior to purchase or sale. If well water is used for drinking purposes, we recommend it be tested by a lab or the health dept. Underground septic systems, sewer lines, and water treatment equipment are not inspected. If present, we recommend a septic system inspection and/or contractor evaluation before closing. The home inspector is not required to: state the effectiveness of anti-siphon devices; determine whether water supply and waste disposal systems are public or private; operate automatic safety controls; operate any valve except water closet flush valves, fixture faucets, and hose faucets. The home inspector is not required to inspect: water conditioning systems; fire and lawn sprinkler systems; on-site water supply quantity and quality; on-site waste disposal systems; foundation irrigation systems; bathroom spas, except as to functional flow and functional drainage; swimming pools; solar water heating equipment; or inspect the system for proper sizing, design, or use of proper materials.

| S = Item is satisfactory $R = Item needs repair$ $I = Item needs investigated$ | \mathbf{NP} = Item not present | NI = Item not inspected |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------|--------------------------------|
| ELECTRICAL Report Number T47U24R6706 | = Tips, Tools, and Sa | avings S R I NP NI |
| SERVICE ENTRANCE- Underground | | |
| | | |
| SERVICE WIRES SIZE & TYPE- 4/0 Aluminum = 200 Amps & 240 Volts X 2 | | |
| · | | |
| CROUNDING FOURIENT FINANCE OF THE STATE OF T | | |
| GROUNDING EQUIPMENT- ☐ Not Present | | |
| | | |
| MAIN PANEL- Located at- Outside | | |
| | | |
| SUB PANELS- Located at- Exterior at the AC unit and in the garage | | |
| | | |
| OVER CURRENT/FAULT PROTECTION- ✓ ARC Breaker ✓ Circuit Breakers F | uses | |
| | | |
| GROUND FAULT Raths Fxterior Kitchen | | 63 |
| PROTECTION- | | |
| Currently present at: | | |
| | | |
| 110 VOLT CIRCUITS - Material- ☐ Aluminum | Inspect | |
| The Fold Charles Marketing Printing in the Copper Countries | поресс | |
| | | |
| 220 VOLT CIRCUITS - Material- ✓ Aluminum ✓ Copper Could not | Inspect | |
| | | |
| RECEPTACLES (representative #)- Type- □ 2 Prong ▼ 3 Prong | | |
| | | |
| INTERIOR LIGHT FIXTURES, CEILING FANS & SWITCHES | | |
| | | |
| EXTERIOR LIGHT FIXTURES, CEILING FANS & SWITCHES | | |
| EATERIOR EIGHT FIATURES, CEILING FANS & SWITCHES | | |
| | | |
| SMOKE DETECTORS | | |
| | | |
| DOORBELL | | |
| | | |
| ADDITIONAL ELECTRICAL ITEM (IF N | EEDED) | |
| | | |
| | | |

| S = Item is satisfactory | R = Item ne Report Number | eds repair | I = Item needs investigated | \mathbf{NP} = Item not present | NI = Item not inspected |
|-------------------------------------------------|-------------------------------------|--------------------|-------------------------------------------------------------------------------------------------------------------|-----------------------------------|--------------------------------|
| HEATING | T47U24R6706 | | | = Tips, Tools, and | d Savings S R I NP NI |
| HEATING UNIT M | FG # 1 | HEATING UN | IT DESCRIPTION | SYSTEM | TYPE |
| Amanna | | ☐ Baseboard | ☐ Hot Water ☐ Steam | Central | Package System |
| MODEL NUMBER | | Forced Air | Radiant Heat | ☐ Room unit | Split System |
| GMH9505DXAB | | ☐ Heat Pump | □ Solar | | |
| SERIAL NUMBER | | r | | LIMIT LOCATION | |
| 0805611662 | | TOTAL CAPA | CITY(in BTU's) | UNIT LOCATION | 1 |
| ENERGY SOURCE | | 92,000 | | | utside |
| ☐ Electric ☐ Oil | | | | ☐ Basement | |
| ▼ Natural Gas □ Prop | oane | | | Crawlspace | |
| | | APPROXIMA | TE AGE(in years) | ☐ Garage | |
| Area Served: 1st Floor | | 2 | | ☐ Inside | |
| HEATING EQUIPM | | | | | |
| start and stop in a very s | hort period of time. | When running the | as noted in the crawl space at the H furnace had a rumbling noise. I tu any needed repairs by a qualified p | irned the unit off at the crawl s | pace switch |
| OPERATION - AIR TI | | Return - 75 | Supply - 95 | Total Colore Inc + Ing Inc | |
| | | | ~ upp-J | | |
| OPERATING & SAFE | TY CONTROLS | | | | |
| | | | | | |
| FLUE | | | | | |
| The furnace in the crawl should make any needed | | screen placed ove | er the opening of the flue pipe to pr | revent pest from entering. A re | pair professional |
| | 1 | ADDITI | ONAL HEATING ITEM (IF N | EEDED) | |
| | | | | | |
| | | | | | |
| | | | | | |
| HEATING UNIT M | FG # 2 | HEATING UN | IT DESCRIPTION | SYSTEM | ТҮРЕ |
| Goodman | | ☐ Baseboard | ☐ Hot Water ☐ Steam | Central | ☐ Package System |
| MODEL NUMBER | | ▼ Forced Air | Radiant Heat | Room unit | ▼ Split System |
| ARUF486016BA | | ✓ Heat Pump | □ Solar | | . , |
| SERIAL NUMBER | | = 11eut 1 ump | _ 50.00 | 1337 1 0 C (T103) | |
| 0804287889 | | TOTAL CAPA | CITY(in BTU's) | UNIT LOCATION | |
| ENERGY SOURCE | | na | | | utside |
| ▼ Electric □ Oil | | | | ☐ Basement | |
| ☐ Natural Gas ☐ Prop | oane | | | ☐ Crawlspace | |
| • | | APPROXIMA | TE AGE(in years) | ☐ Garage | |
| Area Served: | | 2 | | ☐ Inside | |
| 2nd Floor | | | | | |
| HEATING EQUIPM | MENT | | | | |
| | | | | | |
| OPERATION - AIR TI | EMP. RISE | Return - 70 | Supply - 95 | | |
| | | | | | |
| OPERATING & SAFE | TY CONTROLS | | | | |
| 1 | | | | | |

| S = Item is satisfactory | \mathbf{R} = Item needs repair | I = Item needs investigated NP | = Item not present | NI = Item not inspected |
|--------------------------|----------------------------------|-----------------------------------|----------------------|--------------------------------|
| HEATING | Report Number T47U24R6706 | | = Tips, Tools, and S | avings SRINPNI |
| FLUE | | | | |
| | | | | |
| | | | | |
| | AD | DITIONAL HEATING ITEM (IF NEEDED) | | |
| | | | | |
| | | | | |
| | | | | |

Note: Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified repair person prior to purchase or sale. For gas or oil furnaces, the only cover that was removed was the access cover on the burner assembly. The heat exchanger cannot be examined without extensive disassembly of the cabinet. Since this is not possible during a standard, visual home inspection, you may want to obtain a warranty contract on heating units and / or have heat exchanger technically evaluated by an HVAC technician prior to sale. Cracks in flue liners are often concealed by the normal build up of creosote. Our visual inspection may not detect all possible problems with chinmeys. The home inspector is not required to: operate heating systems when weather conditions or other circumstances may cause equipment damage; operate automatic safety controls; ignite or extinguish solid fuel fires; or ignite a pilot light. The home inspector is not required to inspect: the interior of flues; fireplace insert flue connections; heat exchanger; humidifiers; electronic air filters; the uniformity or adequacy of heat supply (air flow) to the various rooms; or solar space heating equipment.

| S = Item is satisfactory | | needs repair | I = Item needs investigated | NP = Item not present | N1 = Item not inspected |
|------------------------------------------------------|------------------------------|--------------|---------------------------------------|----------------------------------|-------------------------|
| HEATING | Report Number T47U24R6706 | | FIREPLACE | = Tips, Tools, and | Savings S R I NP NI |
| FIREPLACE # 1- | Description: | Metal | Location: | Den | |
| | | | | | |
| GAS LOGS | | | | | |
| The gas logs did not have called to light and re ins | | | tion. Home inspectors can not light t | he pilot light. A gas profession | al should be |
| DAMPER | | | | | |
| | | | | | |
| CHIMNEY/FLUE CO | NDITION | | | | |
| | | | | | |
| | | ADDIT | TIONAL FIREPLACE ITEM (IF N | EEDED) | |
| | | | | | |
| | | | | | |
| | | | | | |


Note: Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified repair person prior to purchase or sale. For gas or oil furnaces, the only cover that was removed was the access cover on the burner assembly. The heat exchanger cannot be examined without extensive disassembly of the cabinet. Since this is not possible during a standard, visual home inspection, you may want to obtain a warranty contract on heating units and / or have heat exchanger technically evaluated by an HVAC technician prior to sale. Cracks in flue liners are often concealed by the normal build up of creosote. Our visual inspection may not detect all possible problems with chinmeys. The home inspector is not required to: operate heating systems when weather conditions or other circumstances may cause equipment damage; operate automatic safety controls; ignite or extinguish solid fuel fires; or ignite a pilot light. The home inspector is not required to inspect: the interior of flues; fireplace insert flue connections; heat exchanger; humidifiers; electronic air filters; the uniformity or adequacy of heat supply (air flow) to the various rooms; or solar space heating equipment.

| OPERATION - AIR TEMP, DROP Return - NA Supply - NA The air conditioner serving the main level was not tested due manufacturer's recommendations not to operate when the outdoor tempera less than 65 degrees. Unit should be serviced by a HVAC professional. A/C OPERATING CONTROLS ADDITIONAL A/C ITEM (IF NEEDED) Inside Outside GSH130481AD For Split system SERIAL NUMBER 0807648456 ENERGY TOTAL CAPACITY(in Tons) Size Not Determined 2 APPROXIMATE AGE(in years) For Electric Gas AREA SERVED: 2 AREA SERVED: 2 AREA SERVED: 2 OPERATION - AIR TEMP, DROP Return - na Supply - na Cooling function of heat pump at the second floor was not tested due manufacturers recommendations not to operate when the outdoor less than 65 degrees. Unit should be serviced by a qualified HVAC professional before closing. | I = Item not inspected |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------|
| Goodman | ngs S R I NP NI |
| MODEL NUMBER Room units Package system | |
| GSC130481AG | |
| SERIAL NUMBER 0807008811 TOTAL CAPACITY (in Tons) Size Not Determined 2 APPROXIMATE AGE(in years) F Electric Gas APPROXIMATE AGE(in years) F Gas APPROXIMATE AGE(in years) F Gas APPROXIMATE AGE(in years) F Gas ACC EQUIPMENT OPERATION - AIR TEMP. DROP ACC EQUIPMENT ACC OPERATING CONTROLS ACC OPERATING CONTROLS ACC OPERATING CONTROLS ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM ADDITIONAL A/C ITEM (IF NEEDED) A/C Split system SERIAL NUMBER SSO7648456 FNERGY TOTAL CAPACITY (in Tonn) SERIAL NUMBER SSTEN SOTO DETERMINED APPROXIMATE AGE(in years) F Electric SYSTEM DETERMINED AREA SERVED: 2 APPROXIMATE AGE(in years) F Electric Gas ACC EQUIPMENT OPERATION - AIR TEMP. DROP Return - na Supply - na Cooling function of heat pump at the second floor was not tested due manufacturers recommendations not to operate when the outdoor less than 65 degrees. Unit should be serviced by a qualified HVAC professional before closing. | |
| SERIAL NUMBER (88700881) TOTAL CAPACITY (in Tons) Size Not Determined 2 APPROXIMATE AGE(in years) Filectric Gas AREA SERVED: 1st. Floor ACC EQUIPMENT OPERATION - AIR TEMP, DROP Return - NA Supply - NA The air conditioner serving the main level was not tested due manufacturer's recommendations not to operate when the outdoor temperal tess than 65 degrees. Until should be serviced by a HVAC professional. ACC OPERATING CONTROLS AJC MFG UNIT # 2 SYSTEM TYPE ADDITIONAL A/C ITEM (IF NEEDED) AJC MFG UNIT # 2 SYSTEM TYPE ADDITIONAL A/C ITEM (IF NEEDED) AJC MFG UNIT # 2 SYSTEM TYPE ADDITIONAL A/C ITEM (IF NEEDED) AJC MFG UNIT # 2 SYSTEM TYPE ADDITIONAL A/C ITEM (IF NEEDED) AJC MFG UNIT # 2 SYSTEM TYPE ADDITIONAL A/C ITEM (IF NEEDED) AJC MFG UNIT # 2 SYSTEM TYPE LOCATION Goodman F Central Dual zone Inside MODEL NUMBER SSPIIS SSPIIS SSSSSSSSSSSSSSSSSSSSSSSS | |
| APPROXIMATE AGE(in years) Size Not Determined 2 Gas AREA SERVED: 3I, Floor A/C EQUIPMENT | |
| Size Not Determined APPROXIMATE AGE(in years) Size Not Determined ACF EQUIPMENT OPERATION - AIR TEMP. DROP Return - NA Supply - NA The air conditioner serving the main level was not tested due manufacturer's recommendations not to operate when the outdoor temperal less than 65 degrees. Unit should be serviced by a HVAC professional. ACC OPERATING CONTROLS ADDITIONAL A/C ITEM (IF NEEDED) ACC OPERATING CONTROLS APPROXIMATE AGE(in years) APPROXIMATE AGE(in years) ACC OPERATION CONTROLS ACC OPERATION CONTROLS ACC OPERATION CONTROLS APPROXIMATE AGE(in years) ACC OPERATION CONTROLS ACC OPERATION CONTROLS APPROXIMATE AGE(in years) APPROXIMATE AGE(in yea | |
| Size Not Determined 2 AREA SERVED: 3Ist. Floor A/C EQUIPMENT OPERATION - AIR TEMP. DROP Return - NA Supply - NA The air conditioner serving the main level was not tested due manufacturer's recommendations not to operate when the outdoor temperal less stant 65 degrees. Unit should be serviced by a HVAC professional. A/C OPERATING CONTROLS ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM TYPE LOCATION ADDITIONAL A/C ITEM (IF NEEDED) ADDITIONAL A/C ITEM (IF NEEDED) ADDITIONAL A/C ITEM (IF NEEDED) SERIAL NUMBER GSH130481AD F Room units Package system SERIAL NUMBER SERIAL NUMBER OPERATION - AIR TEMP. DROP Return - na Supply - na Cooling function of heat pump at the second floor was not tested due manufacturers recommendations not to operate when the outdoor less than 65 degrees. Unit should be serviced by a qualified HVAC professional before clossing. | |
| A/C EQUIPMENT OPERATION - AIR TEMP. DROP Return - NA Supply - NA The air conditioner serving the main level was not tested due manufacturer's recommendations not to operate when the outdoor temperaless than 65 degrees. Unit should be serviced by a HVAC professional. A/C OPERATING CONTROLS A/C MFG UNIT # 2 SYSTEM TYPE LOCATION ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM TYPE LOCATION Goodman | |
| A/C EQUIPMENT OPERATION - AIR TEMP. DROP Return - NA Supply - NA The air conditioner serving the main level was not tested due manufacturer's recommendations not to operate when the outdoor temperaless than 65 degrees. Unit should be serviced by a HVAC professional. A/C OPERATING CONTROLS ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM TYPE LOCATION Goodman | |
| OPERATION - AIR TEMP. DROP Return - NA Supply - NA The air conditioner serving the main level was not tested due manufacturer's recommendations not to operate when the outdoor temperal less than 65 degrees. Unit should be serviced by a HVAC professional. A/C OPERATING CONTROLS ADDITIONAL A/C ITEM (IF NEEDED) APPROXIMATE AGE(in years) For Electric Gas APPROXIMATE AGE(in years) For Electric Gas AREA SERVED: APPROXIMATE AGE(in years) For Electric Gas ACC EQUIPMENT OPERATION - AIR TEMP. DROP Return - na Supply - na Cooling function of heat pump at the second floor was not tested due manufacturers recommendations not to operate when the outdoor less than 65 degrees. Unit should be serviced by a qualified HVAC professional before closing. | |
| The air conditioner serving the main level was not tested due manufacturer's recommendations not to operate when the outdoor temperaless than 65 degrees. Unit should be serviced by a HVAC professional. A/C OPERATING CONTROLS ADDITIONAL A/C ITEM (IF NEEDED) ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM TYPE LOCATION Goodman | |
| The air conditioner serving the main level was not tested due manufacturer's recommendations not to operate when the outdoor temperaless than 65 degrees. Unit should be serviced by a HVAC professional. A/C OPERATING CONTROLS ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM TYPE LOCATION ADDITIONAL A/C ITEM (IF NEEDED) ADDITIONAL A/C ITEM (IF NEEDED) A/C MFG UNIT # 2 SYSTEM TYPE LOCATION Goodman | |
| less than 65 degrees. Unit should be serviced by a HVAC professional. A/C OPERATING CONTROLS ADDITIONAL A/C ITEM (IF NEEDED) Inside MODEL NUMBER GSH 130481AD FOR Central Dual zone Inside MODEL NUMBER GSH 130481AD FOR Split system SERIAL NUMBER 80807648456 ENERGY TOTAL CAPACITY(in Tons) Size Not Determined 2 APPROXIMATE AGE(in years) FOR Electric Gas AREA SERVED: 2 AREA SERVED: 2 AC EQUIPMENT OPERATION - AIR TEMP. DROP Return - na Supply - na Cooling function of heat pump at the second floor was not tested due manufacturers recommendations not to operate when the outdoor less than 65 degrees. Unit should be serviced by a qualified HVAC professional before closing. | |
| A/C MFG UNIT # 2 SYSTEM TYPE LOCATION Goodman | ature is |
| A/C MFG UNIT # 2 SYSTEM TYPE LOCATION Goodman Central Dual zone Inside MODEL NUMBER GSH130481AD SERIAL NUMBER SERIAL NUMBER 80807648456 ENERGY TOTAL CAPACITY(in Tons) Size Not Determined 2 APPROXIMATE AGE(in years) F Electric Gas ACE QUIPMENT OPERATION - AIR TEMP. DROP Return - na Supply - na Cooling function of heat pump at the second floor was not tested due manufacturers recommendations not to operate when the outdoor test than 65 degrees. Unit should be serviced by a qualified HVAC professional before closing. | |
| A/C MFG UNIT # 2 SYSTEM TYPE LOCATION Goodman | |
| A/C MFG UNIT # 2 SYSTEM TYPE LOCATION Goodman | |
| Goodman Central Dual zone Inside | |
| Goodman Central Dual zone Inside | |
| Goodman Central Dual zone Inside | |
| Size Not Determined 2 AREA SERVED: 2nd. Floor A/C EQUIPMENT OPERATION - AIR TEMP. DROP Return - na Supply - na Cooling function of heat pump at the second floor was not tested due manufacturers recommendations not to operate when the outdoor cless than 65 degrees. Unit should be serviced by a qualified HVAC professional before closing. | |
| Size Not Determined AREA SERVED: 2nd. Floor A/C EQUIPMENT OPERATION - AIR TEMP. DROP Return - na Supply - na Cooling function of heat pump at the second floor was not tested due manufacturers recommendations not to operate when the outdoor less than 65 degrees. Unit should be serviced by a qualified HVAC professional before closing. | |
| AREA SERVED: 2nd. Floor A/C EQUIPMENT OPERATION - AIR TEMP. DROP Return - na Supply - na Cooling function of heat pump at the second floor was not tested due manufacturers recommendations not to operate when the outdoor less than 65 degrees. Unit should be serviced by a qualified HVAC professional before closing. | |
| A/C EQUIPMENT OPERATION - AIR TEMP. DROP Return - na Supply - na Cooling function of heat pump at the second floor was not tested due manufacturers recommendations not to operate when the outdoor less than 65 degrees. Unit should be serviced by a qualified HVAC professional before closing. | |
| OPERATION - AIR TEMP. DROP Return - na Supply - na Cooling function of heat pump at the second floor was not tested due manufacturers recommendations not to operate when the outdoor less than 65 degrees. Unit should be serviced by a qualified HVAC professional before closing. | |
| Cooling function of heat pump at the second floor was not tested due manufacturers recommendations not to operate when the outdoor less than 65 degrees. Unit should be serviced by a qualified HVAC professional before closing. | |
| Cooling function of heat pump at the second floor was not tested due manufacturers recommendations not to operate when the outdoor less than 65 degrees. Unit should be serviced by a qualified HVAC professional before closing. | |
| less than 65 degrees. Unit should be serviced by a qualified HVAC professional before closing. | |
| A/C OPERATING CONTROLS | |
| | |
| ! | |

d \mathbf{NP} = Item not present

NI = Item not inspected

= Tips, Tools, and Savings

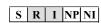

Note: Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified repair person prior to purchase or sale. This report does not reflect a technically exhaustive evaluation and should not be interpreted as a prediction of the remaining life expectancy of the air conditioner. Special HVAC license is required to check refrigerant pressures and other internal components. If you wish to have a technical evaluation, we suggest you have the system serviced and evaluated by a licensed HVAC technician. the home inspector is not required to: operate cooling systems when weather conditions or other circumstances may cause equipment damage; inspect window air conditioners; or inspect the uniformity or adequacy of cool-air supply to the various rooms.

| S = Item is satisfactory R | = Item needs repair | I = Item needs investigated NI | P = Item not present NI = | Item no | t insp | ected |
|------------------------------------|----------------------------------------------------------------|--------------------------------|----------------------------|----------|--------|-------|
| HVAC Distribution | Report Number T47U24R6706 | | = Tips, Tools, and Savings | SR | | NP N |
| DUCTS- (includes supports & insl.) | ✓ Flex ☐ None✓ Insulated ☐ Sheet Me | ☐ Uninsulated | | r l | Г | |
| | | | | <u> </u> | | |
| FILTER - Size(s): 20 X 20 X 1 | | | | | П | |
| | | | | | | |
| | ADDITI | ONAL DUCT ITEM (IF NEEDED) | | | | |
| | | | | | | |
| | | | | · | | |

| S = Item is satisfactory | | I = Item needs investigated | \mathbf{NP} = Item not present | NI = Item not inspected |
|--------------------------|-------------------------------------|------------------------------------|----------------------------------|-------------------------|
| INTERIOR | Report Number T47U24R6706 | | = Tips, Tools, and | d Savings S R I NP NI |
| WALLS & CEILINGS | | | | |
| | | | | |
| FLOORS (does not inc | lude carpeting or finish treatments |) | | |
| | | | | |
| STEPS & STAIRWAY | S | | | |
| | | | | |
| INTERIOR BALCON | Y & RAILINGS | | | |
| | | | | |
| COUNTERS & BUILT | -IN CABINETS (representative #) | | | |
| | | | | |
| INTERIOR DOORS (1 | representative #) | | | |
| | | | | |
| WINDOWS (interior s | ide of windows) | | | |
| | | | | |
| | ADDIT | IONAL INTERIOR ITEMS (IF N | EEDED) | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |

| S = Item is satisfa | actory | $\mathbf{R} = Ite$ | em needs re | | | em needs investigated | NP = Item not present | NI = | Iten | not : | insp | ecte | d |
|----------------------------|---------|--------------------|-----------------|--------|--------------------------|----------------------------|-----------------------|-------|----------|-------|------|------|----|
| INSULATI | ON & V | VENTILA | TION | Report | ort Number U24R6706 | | = Tips, Tools, and Sa | wings | S | R | I | NP | ΝI |
| BASEMENT INSULATION- | | in. thick | ☐ Blow ☐ Cellu | | ☐ Fiberglass ☐ Rock wool | ☐ Roll/batt ☐ Vermiculite | | | | | | 굣 | Γ |
| CRAWLSPACE INSULATION- | 6 1/4 | in. thick | ☐ Blow | | ☐ Fiberglass ☐ Rock wool | ▼ Roll/batt Vermiculite | | Ü | V | П | | | Γ |
| ATTIC INSULATION- | 6 1/2 | in. thick | | | ☐ Fiberglass ☐ Rock wool | ☐ Roll/batt ☐ Vermiculite | | | \ | | | | |
| VAPOR RETAR | DERS- | | ☐ Kraft | back | ed paper | | ☐ Other | | | | | V | Γ |
| CRAWLSPACE VENTILATION- | - | | ▼ 8" x 1 | 16" F | oundation Vents | Other Screened Crawl Door | | | \ | | | | |
| ATTIC VENTILATION- | - | | ☐ Louv | | Č | Static Turbine | | | V | | | | |
| WHOLE HOUSE | E FAN | | | | | | | | | | | ⊽ | Г |
| BATHROOM VI | ENTS- | To attic & o | ver to soffit | ; | | | | | V | | | | Γ |
| DRYER VENT- | To exte | erior wall | | | | | | ij | | | | | Г |
| | | | | ADI | DITIONAL INS | SULATION ITEMS (IF N | NEEDED) | | | | | 굣 | Γ |
| | | | | | | | | | П | | | 굣 | Γ |
| | | | | | | | | | | | | | |

Note: Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified repair person prior to purchase or sale. The home inspector is not required to report on: concealed insulation and vapor retarders; or venting equipment that is integral with household appliances. The home inspector shall: move insulation where readily visible evidence indicates the possibility of a problem; and move floor insulation where plumbing drain/waste pipes penetrate floors, adjacent to earth-filled stoops or porches, and at exterior doors.

| S = Item is satisfactory | | Item needs investigated | \mathbf{NP} = Item not present | NI = Item not inspected |
|------------------------------------------------------|----------------------------------|--------------------------|----------------------------------|--------------------------------|
| BUILT-IN KITCHEN APP | Report Number T47U24R6706 | r i | = Tips, Tools, and | d Savings S R I NP NI |
| KITCHEN # 1 | <u>Manufacturer</u> | Model # | Serial # | |
| DISHWASHER | KitchenAid | | | |
| | | | | |
| RANGE- Electric | Kitchen Aid | | | |
| OVEN- Electric | Kitchen Aid | | | |
| TRASH COMPACTOR | | | | |
| GARBAGE DISPOSAL | Ise | | | |
| RANGE HOOD VENT The pop up range hood did not respon | Kitchen Aid | ha a salified sonois see | faccional | |
| The pop up range nood did not respon | nd when tested. Repair is needed | by a quantied repair pro | ressional. | |
| MICROWAVE (Built-in) | Kitchen Aid | | | |
| | | | | |
| REFRIGERATOR | | | | |
| | | | | |
| | ADDITIONAL A | APPLIANCE ITEMS (II | F NEEDED) | |
| | | | | |
| | | | | |
| | | | | |

Note: Washers and dryers are normally considered personal property and are not checked if present. Due to time constraints, self cleaning options on ovens are not tested. Since appliances are only turned on for a short period of time, extensive testing of timers, thermostats and other controls is not possible. Any appliance that is over ten years old is considered past its normal life expectancy. Appliances can fail at any time regardless of age: consider purchasing a home warranty service contract to cover repair or replacement. The home inspector is not required to inspect: locks, timers, self-cleaning oven functions, or thermostats for calibration or automatic operation; non built-in appliances; or refrigeration units. The home inspector is not required to operate: appliances in use; or any appliance that is shut down or otherwise inoperable.

| SAFETY INSPECTON | Report Number T47U24R6706 | | 63 | - Ti T1 1 Ci |
|-------------------------|------------------------------|--------------------------------------|-----------|----------------------------|
| CMOVE DETECTORS # 7 | 14/U24R6/06 | CMOVE DETECTORS WORKS | V | = Tips, Tools, and Savings |
| SMOKE DETECTORS # - 7 | | SMOKE DETECTORS WORK? - | Yes | |
| | | | | |
| CARBON MONOXIDE DETECT | ΓORS # - 1 | CARBON MONOXIDE DETECTORS WORKING? - | Yes | |
| | | | | |
| DEADBOLTS INSTALLED? - | Yes | DEADBOLTS WORKING? - | No | |
| | | | | |
| FIRE EXTINGUISHERS # - | | | | |
| | | | | |
| SECURITY SYSTEM INSTALL | ED? | | | |
| | | | | |
| | | ADDITIONAL SAFETY ITEMS (IF NEEDED) | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |

We are proud to provide this Safety Report with support from Nationwide Insurance, ADT, and Safe Homes for Safe Kids.

Please review entire report for other safety related items.







SUPPLEMENTAL INFORMATION

Report Number T47U24R6706

All directional references are made facing the front door of the house. This report is intended for the exclusive use of our client. Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified and or licensed trade professional prior to purchase or sale. This is a visual inspection of readily accessible components only and is not technically exhaustive.

Home inspectors are NOT required to report on: the life expectancy of any component or system; the causes of the need for a repair; the methods, materials and costs of corrections; the suitability of the property for any specialized use; compliance or noncompliance with codes, ordinances, statutes, regulatory requirements or restrictions; the market value of a property or its marketability; the advisability or inadvisability of purchase of the property; any component or system that was not inspected; the presence or absence of pests such as wood damaging organisms, rodents, or insects; cosmetic damage, underground items, or items not permanently installed - any information given on these items should be considered incomplete and should be further evaluated prior to sale.

Home inspectors are NOT required to: offer warranties or guarantees of any kind; calculate the strength, adequacy, or efficiency of any system or component; enter any area or perform any procedure that may damage the property or its components or be dangerous to adversely affect the health or safety of the home inspector or other persons; operate any system that has been shut down or otherwise inoperable; operate any system that does not respond to normal controls; move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; determine the presence or absence of any suspected adverse environmental condition or hazardous substance - including toxins, mold, mildew, microbial organism, radon gas, lead paint, carcinogens, noise, contaminants in the building or in soil, water or air; determine the effectiveness of any system installed to control or remove suspected hazardous substances; predict future condition, including failure of components; project operating costs of components; evaluate acoustical characteristics of any system or component; inspect special equipment or accessories that are not listed in this report; disturb insulation except: where readily visible evidence indicates the possibility of a problem, where plumbing drain/waste pipes penetrate floors and adjacent to earth filled stoops or porches and at exterior doors - any information given on these items should be considered incomplete and should be further evaluated prior to sale. Home inspectors shall NOT: Offer or perform any act or service contrary to law; offer to perform engineering, architectural, plumbing, electrical or any job function requiring an occupational license in the jurisdiction where the inspection is taking place, unless the home inspector holds a valid occupational license, in which case the home inspector shall inform the client that the the home inspector is so licensed, and therefore qualified to go beyond this section and perform additional inspections beyond

STRUCTURAL

Note: Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified repair person prior to purchase or sale. Due to recent advances in modular construction techniques, it is sometimes difficult to determine if a home is modular or "stick built". Therefore, no determination was made by the inspector other than a general framing description.

EXTERIOR

Note: Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified repair person prior to purchase or sale. Conditions behind siding, gutters, awnings and heavy shrubbery are not visible and are expressly excluded from this report. Representative site drainage cannot be accessed if it has been dry for an extended period of time. No guarantee is made for compromised insulation seals on windows and doors because this condition may only be apparent during certain weather conditions. The home inspector is NOT required to inspect storm windows & doors, screening, shutters, awnings, and similar seasonal accessories; fences; presence of safety glazing in doors and windows; garage door remote controls; geological and soil conditions; recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment or athletic facilities); detached buildings or structures; any environmental hazard or buried fuel tanks.

ELECTRICAL

Note: Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified repair person prior to purchase or sale. The home inspector is not required to: insert any tool, probe, or testing device inside the panels; test or operate any over current device except ground fault circuit interrupters; dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; operate and test smoke detectors when detectors are part of a central system. The home inspector is not required to inspect: low voltage systems; security system devices, heat detectors, or carbon monoxide detectors; telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or built-in vacuum equipment. "Representative number" means, for multiple identical components such as electrical outlets, one such component per room. Safety Note: To help prevent fatal electric shocks, modern standards require Ground Fault Circuit protection at the receptacles serving the kitchen, bathrooms, & laundry (within 6' of sink); also garage, unfinished basements, exterior, crawl space, whirlpools, spas, pools, & fountains - if not present, client should add ground fault protection for personal safety.

PLUMBING

Note: Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified repair person prior to purchase or sale. If well water is used for drinking purposes, we recommend it be tested by a lab or the health dept. Underground septic systems, sewer lines, and water treatment equipment are not inspected. If present, we recommend a septic system inspection and/or contractor evaluation before closing. The home inspector is not required to: state the effectiveness of anti-siphon devices; determine whether water supply and waste disposal systems are public or private; operate automatic safety controls; operate any valve except water closet flush valves, fixture faucets, and hose faucets. The home inspector is not required to inspect: water conditioning systems; fire and lawn sprinkler systems; on-site water supply quantity and quality; on-site waste disposal systems; foundation irrigation systems; bathroom spas, except as to functional flow and functional drainage; swimming pools; solar water heating equipment; or inspect the system for proper sizing, design, or use of proper materials.

SUPPLEMENTAL INFORMATION

Report Number T47U24R6706

INTERIORS

Note: Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified repair person prior to purchase or sale. "Representative number" means, for multiple identical components such as interior doors and windows, one such component shall be operated per room. The home inspector is not required to inspect: paint, wallpaper, and other finish treatments on: interior walls, ceilings, and floors; carpeting, draperies, blinds, or other window treatments.

ROOF

Note: Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified repair person prior to purchase or sale. Apparent serviceability of roofing system is reported but is not a warranty or guarantee of the remaining life expectancy. The home inspector is NOT required to walk on the roofing or inspect attached accessories including solar systems, antennae and lightning arrestors.

INSULATION

Note: Items noted "R" (needing repair) or "I" (needing further investigation) should be repaired and/or evaluated by a qualified repair person prior to purchase or sale. The home inspector is not required to report on: concealed insulation and vapor retarders; or venting equipment that is integral with household appliances. The home inspector shall: move insulation where readily visible evidence indicates the possibility of a problem; and move floor insulation where plumbing drain/waste pipes penetrate floors, adjacent to earth-filled stoops or porches, and at exterior doors.